

SWAG 60 93 3986

SWAG[®]

To fit:
Renault Clio 3, Modus

Engine: K9K
Gearbox: JA5, JR5



EN

Engine mounting

Problem

When the vehicle is in neutral with the engine idling, a vibration/judder can be felt through the vehicle dashboard, accelerator, brake, clutch pedal and seat. Additionally, a 'humming' noise can be heard.

Cause

When exposed to the elements and hot and cold heat cycles, the engine mount's rubber component begins to degrade. In turn, this degradation causes excessive movement of the engine mount.

Solution

Make sure the vibration is being caused by the engine mount by increasing the engine speed to see if the noise disappears or changes tone.

Get the help of an assistant; they can manipulate the mounting by adding pressure to it using a lever bar, which applies a load to the engine mount in several areas. If the noise disappears, the mounting should be replaced.

For more technical information please visit: partsfinder.bilsteingroup.com