

Danger of incorrect application of tensioning pulleys 531 0054 30 and 531 0626 30

Manufacturer:

Opel, Vauxhall, Holden

LuK AS Part No.: 531 0054 30
531 0626 30

OE-No.: 56 36 738
56 36 729

Manufacturer No.: 979195
979488



Fig. 1: 531 0626 30 (979488)



Fig. 2: 531 0626 30 (979488)

When installing the above-listed tensioning pulleys, **correct** vehicle application must be ensured.

Both models appear to be identical from the outside.

The tensioning pulley **531 0626 30** has an extended tensioning range, as well as a higher-temperature bearing.

The tensioning pulleys can be distinguished by the manufacturer number stamped on the rear face (**fig. 2, arrow**).

The pre-tensioning force and the damping of the tensioning pulleys are different!

Incorrect assignment could cause the toothed belt to jump, resulting in damage to the engine.

Appropriate spare parts can be found in our on-line catalogue at www.Schaeffler-Aftermarket.com or at www.RepXpert.com.

Issued 11.2007
INA 0005

Technical subject to change
© 2007 LuK-Aftermarket Service oHG

For further information:

Phone: +44 (0) 14 32 264 264*

Fax: +44 (0) 14 32 275 146

Info@LuK-AS.co.uk

www.Schaeffler-Aftermarket.com

* Calls from within the UK 08457 001100

